
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary ————————————————————————————————————							
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-237	Smoke	8/24/2009	ADS/TM	S1900_030MH	Dry	Yes	832.28

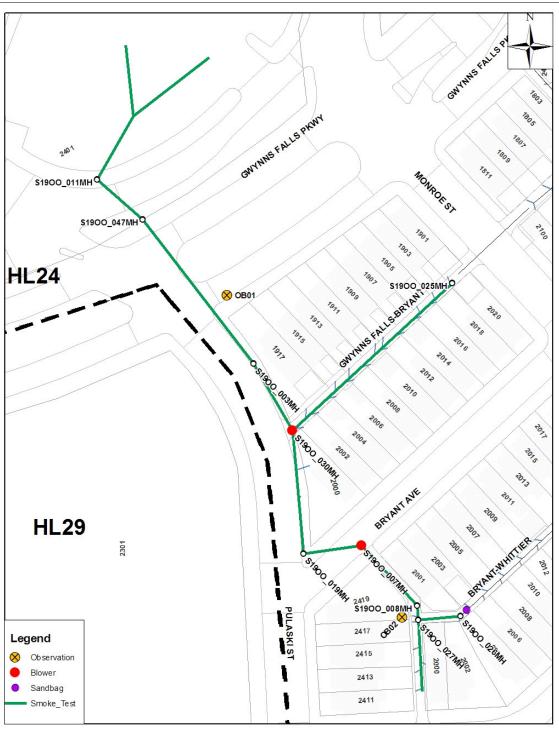

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary							
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-237	Smoke	8/24/2009	ADS/TM	S1900_030MH	Dry	Yes	832.28

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S19OO_007G1	S19OO_007MH	S19OO_008MH	78.293	8
S19OO_027G1	S1900_027MH	S19OO_026MH	40.5881	8
S19OO_025G1	S19OO_025MH	S1900_030MH	208.006	8
S19OO_019G1	S19OO_019MH	S19OO_007MH	56.1587	8
S19OO_036G1	S19OO_036DE	S1900_027MH	68.5957	8
S19OO_047G1	S19OO_047MH	S19OO_003MH	174.351	8
S19OO_030G1	S19OO_030MH	S19OO_019MH	118.208	8
S19OO_003G1	S19OO_003MH	S1900_030MH	74.17	8
S19OO_008G1	S19OO_008MH	S1900_027MH	13.9141	8

Observations & Photos

Obs_ID S1028-237-OB01

Address 1917 Gwynns Falls Pkwy

Status Public
Source Catch Basin
Location Curb

Nearest MH S1900_003MH

Comments Smoke from catch basin along curb. 1917

Gwynns Falls Pkwy.

Picture \S1028-237-OB01-P01.jpg

Comments Front of house, 1917 Gwynns

Falls Pkwy.

Obs_ID S1028-237-OB02 **Address** 2419 Pulaski St

Status Private **Source** Cleanout

Location Paved concrete **Nearest MH** \$1900_008MH

Comments Smoke from above-grade cleanout in paved

concrete in back yard. 2419 Pulaski St.



Picture \S1028-237-OB02-P01.jpg

Comments Back of house, 2419 Pulaski St.